


2019 DOOSAN DX350LC-5

UNIT: DWGCECEBAJ1020302





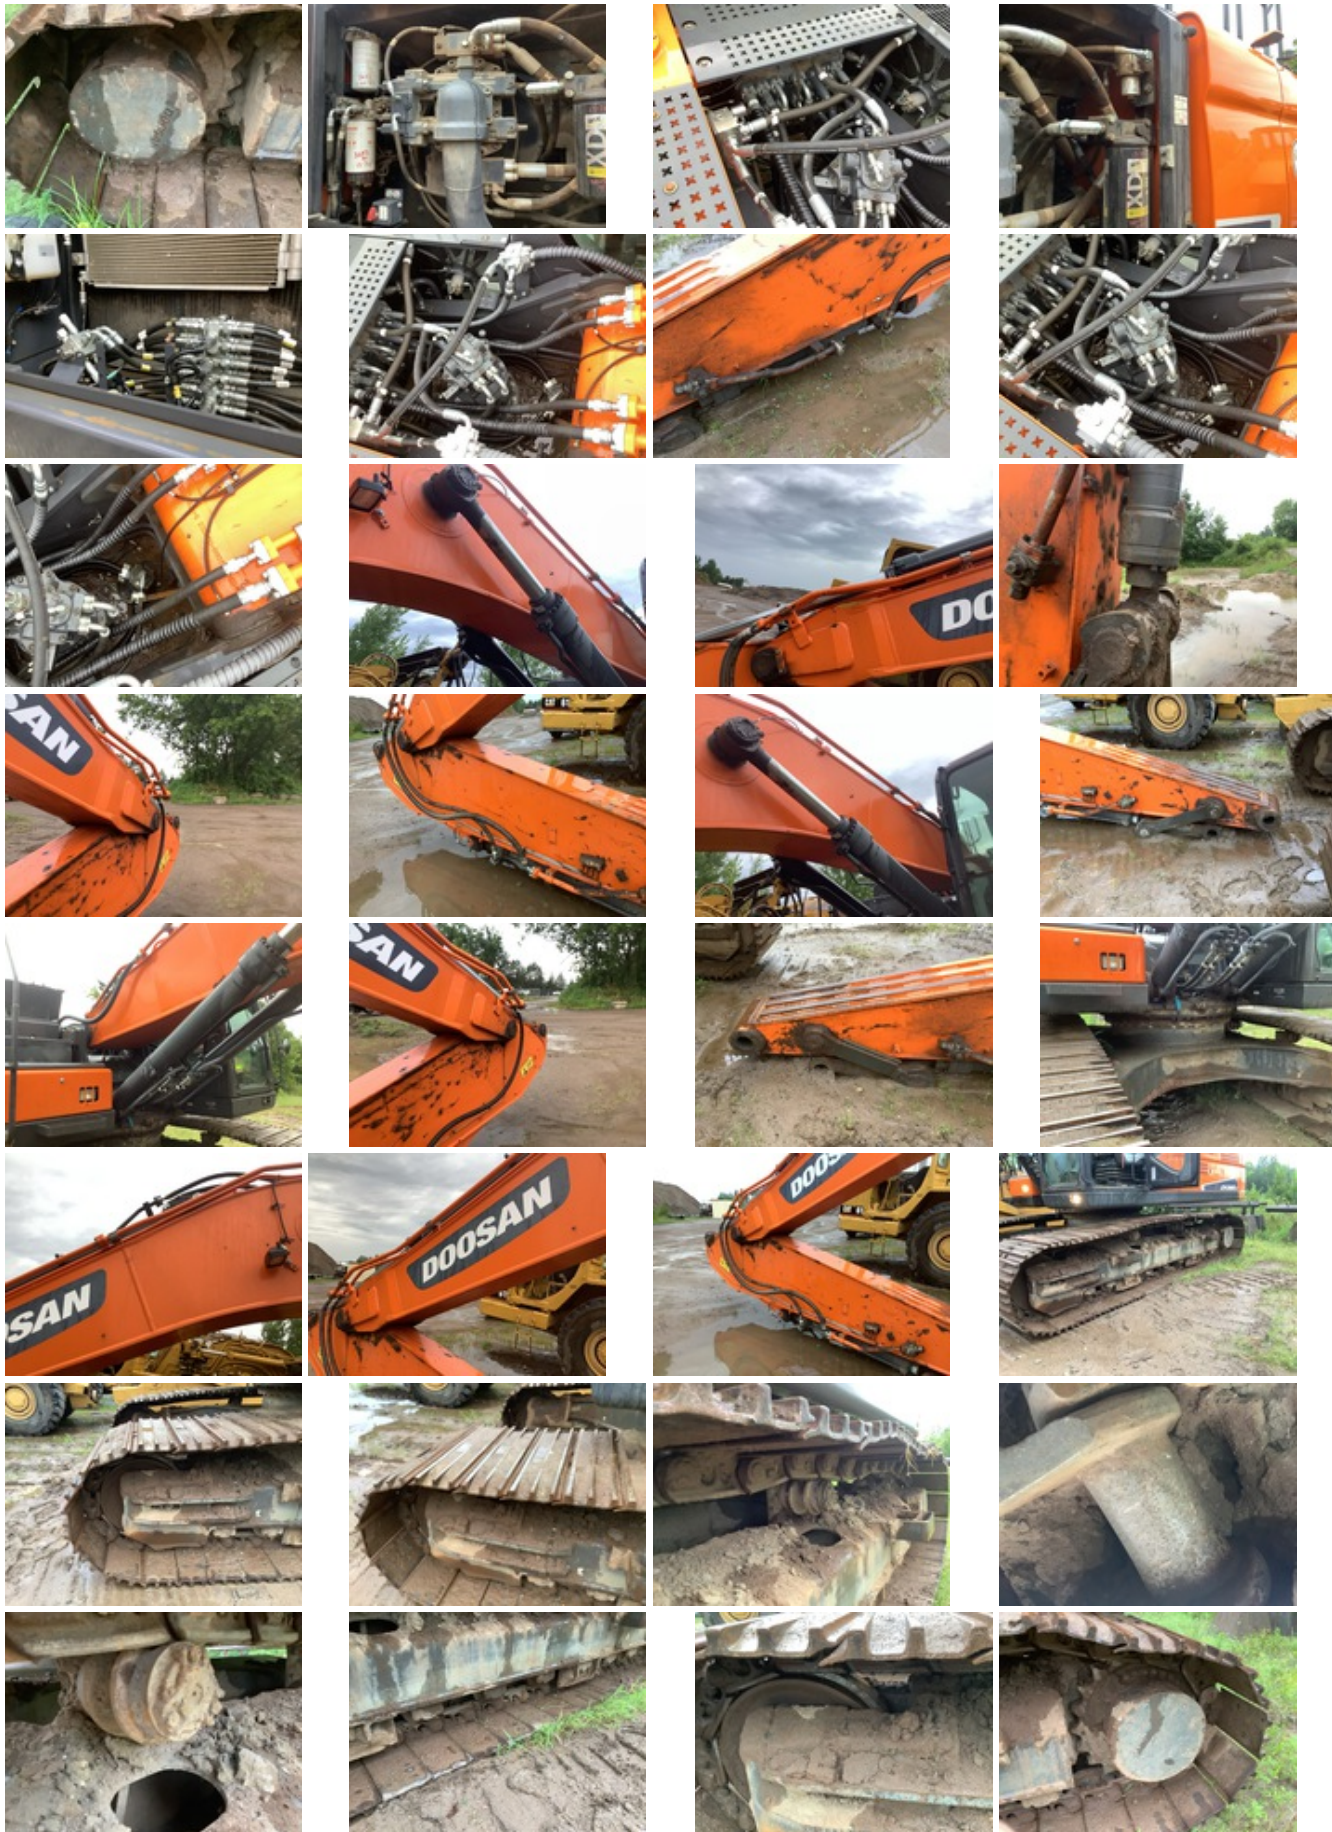



UNIT SPECS

Customer	PNC Equipment Finance	Year	2019
Make	DOOSAN	Model	DX350LC-5
Unit Number	173204		

LOCATION

GUSTAFSON EXCAVATING, INC
 6610 410th Street
 North Branch, MN 55056

GENERAL APPEARANCE

Year
2019

Make
DOOSAN

Model
DX350LC-5

Unit Number

173204

Serial

DWGCECEBAJ1020302

Pre-Operational Checks

Confirm Fluids Checked: Engine Coolant. Confirm Fluids Checked: Engine(s) Oil. Confirm Fluids Checked: Hydraulic Fluid. Confirm Fluids Checked: Fuel Level

Paint

Damage

Body Panels

No visible damage or missing components

Cab/Canopy Overhead Structural Framework

No visible damage

Steps

No visible damage or missing components

Hand Rails

No visible damage or missing components

Exterior Lights

1 Inoperable / damaged / missing

Serial Number / VIN

DWGCECEBAJ1020302

SAFETY

Travel Alarm

Operational

Horn

Operational

Seat Belts

Operational

Safety Lock Out/Stop

Operational

Current Safety Manual

Yes

Current Operator/Maintenance Manual

Yes

CONTROL STATION

Seat/Armrests

Operator seat cushion damaged

Glass

No visible damage or missing components

Cab Door

No visible damage or missing components

Steering Controls

Rating:

Good

Hydraulic Controls

Rating:

Good

Drivetrain Controls

Rating:

Good

Dash Console

Rating:

Good

Engine Oil Pressure

No oil pressure indicator

Warning Lights

Inoperable

Gauges

Operational

Rear View Camera

Camera operates as intended

Hour Meter (Pre-inspection)

4966.7 hrs

Hour Meter

4967 hrs

Air Conditioner

Operational

Heater

Operational

Limited Function Check (Control Station)

The main components are in place and operational as noted.



Control Station

Cab Details:, Air Conditioner, Control Pattern Changer

ENGINE

A/C Compressor

Operational

Blow-by (Subjective Visual Observation)

No noticeable vapor or pressure



Starter

Operational

Exhaust System

No visible damage or missing components

Radiator

Rating:

Good

Oil Leaks

No dripping leaks

Limited Function Check (Engine)

The engine started and ran.



DRIVETRAIN

Left Drive Motor

Rating:

Good

Right Drive Motor

Rating:

Good

Left Final Drive

Rating:

Good

Right Final Drive

Rating:

Good

Limited Function Check (Drivetrain)

The drivetrain was operational.

HYDRAULICS

Pumps (Hydraulics)

Rating:

Good

Valves

Rating:

Good

Hydraulic Tank

Rating:

Good

Hydraulic Control Pattern Changer

Rating:

Good

Hoses (Hydraulics)

Rating:

Good

Auxiliary Hydraulic Plumbing

Not operationally checked, End of stick, Missing the right side hose

Swing Motor

Rating:
Good

Hydraulic Center Swivel

Rating:
Good

Boom Lift Cylinder(s)

Rating:
Good

Stick Cylinder

Rating:
Good

Bucket Cylinder

Rating:
Good

Limited Function Check (Hydraulics)
The hydraulic system was operational.

CHASSIS

Boom/Stick Details

Standard Boom, 13 ft Stick, Auxiliary Hydraulic Plumbing

Boom Condition

Rating:
Good

Stick Condition

Rating:
Good

Boom Base Pin And Bushings

Rating:
Good

Pin And Bushings Boom To Stick

Rating:
Good

Pin And Bushings Stick To Bucket

Rating:
Good

Turntable Bearing

Rating:
Good

Bottom Covers

Rating:
Good

Limited Function Check (Chassis)
The main components were operational in a limited check.

UNDERCARRIAGE

Track Link Brand
Other Doosan Other Doosan

Left Roller Frame
Rating:
Good

Left Track Tensioner
Rating:
Good

Left Track Pads
33 in Wide Triple Grouser
Rating:
Good

Left Grouser Height
38 mm

Left Track Links
117 mm Some links binding

Left Track Bushings
64 mm

Left Carrier Rollers
2 carrier rollers #1 140 mm #2 139 mm

Left Bottom Rollers
9 Bottom Rollers #1 179 mm #2 180 mm #3 rock guard mm #4 180 mm #5 180 mm #6 178 mm #7 rock guard mm #8 179 mm #9 180 mm

Left Idler
25 mm

Left Sprocket
Rating:
Good

Right Roller Frame
Rating:
Good

Right Track Tensioner
Rating:
Good

Right Track Pads
33 in Wide Triple Grouser
Rating:
Good

Right Grouser Height
37 mm

Right Track Links
118 mm Some binding

Right Track Bushings
65 mm

Right Carrier Rollers

2 Carrier Rollers #1 148 mm #2 150 mm

Right Bottom Rollers

9 Bottom Rollers: #1 179 mm #2 178 mm #3 rock guard mm #4 180 mm #5 179 mm #6 180 mm #7 roxk guard mm #8 179 mm #9 178 mm

Right Idler
26 mm

Right Sprocket
Rating:
Good

LOGISTICS INFORMATION

General Shipping Information

Yes: Does this Unit Run? Yes: If self propelled, does the unit travel? Yes: Is the unit taller than 12'? Yes: Is the unit wider than 8'6"? No: Inflated Tires - item can roll? No: Noticeable fluid leaks?

Road Related Shipping Info

Yes: Lights Operate? Yes: Brakes Operate? Yes: Tires OK?

RECONDITIONING

Seat/Armrests: Operator seat cushion damaged \$450

Warning Lights: Inoperable \$500

Paint: Damage \$2,500

Exterior Lights: 1 Inoperable / damaged / missing \$300

Auxiliary Hydraulic Plumbing: Missing the right side hose \$400

Total

\$4,150